

Vehicle

BMW X3 30D A, 190kW

WBAWY  



Development code F25  
 Color black-sapphire metallic  
 Actual integration level F0   506  
 Start of warranty July 16, 2013



There are Technical Campaigns for this vehicle.  
**(Sunt disponibile Campanii Tehnice)**

Technical Campaigns

Status	Campaign number	Description	Reservation
Open	1INFO211056	Service Action in Case of Customer Complaint (SACC): Topic "Exhaust-Gas Recirculation Cooler Nx7"  Local campaign number: -	

Service contracts

No BSI contracts available

Information on faults, workshop/Service Consultation

No information on faults is available.

Navigation map

Installed map	Enabling code (subscription)	Latest nav. map included in subscription	Latest nav. map subject to charge
Road Map Europe MOVE 2016-2 (as of: Jan 17, 2019)	Release code valid for navigation maps with release date up to Oct 31, 2016 (SWID: 00880029).	Road Map Europe MOVE 2017-1	Road Map Europe MOVE 2019

Vehicle details

Vehicle type Passenger car  
 Brand BMW

Model	X3 30D A
Body	GEFZG
Vehicle identification number (last 7 characters)	0 [REDACTED]
Vehicle identification number (17 characters)	WBAW [REDACTED]
Development code	F25
Steering	LL
Engine	N57T
Engine number	301 [REDACTED]
Exhaust re-treatment	EURO5, J, PI/CI, M, N1 I
Transmission	AUT
Transmission number	014 [REDACTED]
Head unit serial number	000011 [REDACTED]
Drive	ALLR
Integration level	F025 [REDACTED] 02
Production date	Jun 16, 2013
Production works	SPARTANBURG
Delivery date	Jul 4, 2013
Delivering Retailers	Eichhorn Automotive GmbH, Miltenberg, DE
National-market version	EUR
Paint number	475
Upholstery code	FHAT
Model code	WY61
Base type	WY51
Lead type	WY61

---

## Optional equipment

---

### Optional equipment fitted at the factory:

01CA Selection of COP relevant vehicles  
 01CC Auto start/stop function  
 01CD Brake Energy Regeneration  
 0205 Automatic transmission  
 0216 Hydro steering-servotronic  
 0226 Sports suspension settings  
 0230 Extra package, EU-specific  
 0249 Multifunction f steering wheel  
 0258 Tire with run-flat functionality  
 02MS BMW LA wheel M Star Spoke 368  
 02VG Performance Control  
 02VL Variable Sport steering  
 0316 automatic trunk lid mechanism  
 0322 Comfort access


### Retrofitted optional equipment:

K235 Retrofit, trailer tow hitch


0337 M Sports package  
 03AG Reversing camera  
 03AP Windshield with grey wedge  
 03AT Roof rail, aluminum, satin finish  
 0402 Electric panoramic roof  
 0413 Trunk room nct  
 0420 Sun protection glazing  
 0423 Floor mats, velours  
 0428 Warning triangle and first aid kit  
 0430 Interior/outside mirror with auto dip  
 0431 Interior mirror with automatic-dip  
 0465 Through-loading system  
 0481 Sports seat  
 0494 Seat heating driver/passenger  
 04AD Interior trim strips, alu, brushed, fine  
 04NG Trim covers, instr. panel, high-gloss  
 04U2 Driving experience switch incl. ECO PRO  
 0502 Headlight cleaning system  
 0508 Park Distance Control (PDC)  
 0520 Fog lights  
 0521 Rain sensor  
 0522 Xenon Light  
 0524 Adaptive Headlights  
 0534 Automatic air conditioning  
 0544 Cruise control with brake function  
 0548 Kilometer-calibrated speedometer  
 0563 Light package  
 05AC High-beam assistant  
 0606 Navigation system Business  
 0698 Area-Code 2 for DVD  
 06NS Convenience phone, expanded Smartphone  
 06VC Control for Combox  
 0715 M Aerodynamics package  
 0760 High gloss shadow line  
 0775 Headlining anthracite  
 07XA M Lcathr. wheel+shift paddle+multifunc.  
 0801 National version Germany  
 0840 High speed synchronisation  
 0851 Language version German  
 0879 On-board vehicle literature German  
 08KA Dummy-SALAPA  
 08TM Dummy-SALAPA  
 08TN Daytime run.lights adjus.via light menu  
 08V1 Label  
 0925 Dummy-SALAPA  
 A090 90 AH AGM battery

## Histories

Date	Type	Vehicle mileage	Dealer	Overview
— 06/28/2019	Key	196367 km	32929 Eichhorn Automotive GmbH, Obernburg	Key 0

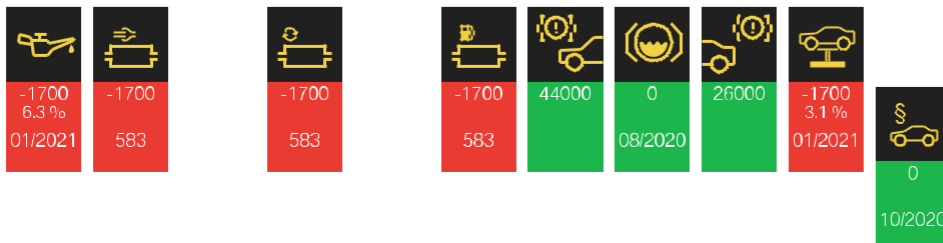

— 06/28/2019 Service 196367 km 32929 Eichhorn Automatic  
Automotive  
GmbH,  
Obernbuurg

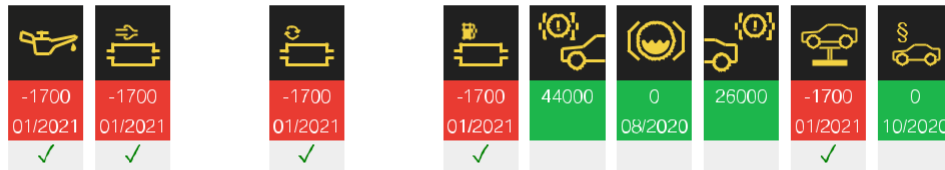

— 06/28/2019 Repair 196373 km 32929 Eichhorn Job  
Automotive Job  
GmbH, Job  
Obernbuurg Job  
Job  
Job  
Job  
Job

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Vehicle check in course of reception 0 FRU  
Flat rate unit I 00 52 054

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Service - standard scope 2 FRU  
Flat rate unit I 00 00 105

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Engine oil service 3 FRU  
Flat rate unit I 00 00 610

---

Set oil-filter element 1  
Part I 11 42 8 507 683

---

Shell Helix Ultra ECT SAE 0W-30 BMW Longlife 04 Local 6.5  
Part I FT9030

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Microfilter service 1 FRU

Flat rate unit I 00 00 616

Microfilter/activated Carbon container  
Part I 64 31 2 284 828

1

— Job

1 FRU

1

5 FRU

1

1

6 FRU







1

— 01/17/2019 Key


167559 km

32929 Eichhorn  
Automotive  
GmbH,  
Oberburg

     Key 0

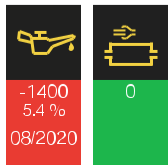

— 01/17/2019 Service 167559 km 32929 Eichhorn Automatic  
Automotive  
GmbH,  
Obernbuurg

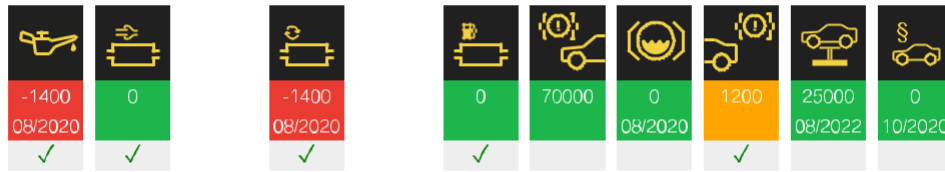

— 01/17/2019 Repair 167559 km 32929 Eichhorn Job  
Automotive Job  
GmbH, Job  
Obernbuurg Job  
Job  
Job  
Job  
Job

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Vehicle check in course of reception Flat rate unit I 00 52 054	0 FRU
--	-------

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

---

Battery Part I 61 31 9 217 643	1
-----------------------------------	---

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

---

Set oil-filter element Part I 11 42 8 507 683	1
--	---

---

Shell Helix Ultra ECT SAE 0W-30 BMW Longlife 04 Part I FT9030	Local	6.5
--	-------	-----

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Microfilter service Flat rate unit I 00 00 616	1 FRU
---	-------

---

Microfilter/activated Carbon container Part I 64 31 2 284 828	1
--	---

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Service fuel filter Flat rate unit I 00 00 604	5 FRU
---	-------

---

Hose clamp Part I 16 12 1 180 240	1
--------------------------------------	---

---

Fuel filter cartridge Part I 13 32 8 584 874	1
---	---

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Service - air filter element Flat rate unit I 00 00 602	1 FRU
--	-------

---

Air filter element Part I 13 71 8 518 111	1
--	---

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Service, rear brakes Flat rate unit I 00 00 614	8 FRU
--	-------

---

Brake pad wear sensor, rear Part I 34 35 6 790 304	1
---	---

---

Brake pad paste Part I 83 19 2 158 851	2
---	---

---

Repair kit, brake pads asbestos-free Part I 34 21 6 796 741	1
--	---

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Windshield Washer Antifreeze Part I 83 12 2 409 031	1
--	---

— 01/17/2019 Warranty 167565 km 32929 Eichhorn Automotive GmbH, Obernburg Job: Exx Fxx Gxx Check exhaust-gas recirculation cooler, replace if necessary

— Job: Exx Fxx Gxx Check exhaust-gas recirculation cooler, replace if necessary

Is interpreted as a repeat visit: No

Customer's own words:

Sight-checking EGR cooler on output side; replacing EGR cooler; cleaning mixing pipe/EGR pipe; function-testing pressure sensors  
Flat rate unit I 00 67 590 26 FRU

Additional work for checking exhaust-gas recirculation cooler label  
Flat rate unit I 00 67 708 1 FRU

Exx Fxx Gxx Check exhaust-gas recirculation cooler, replace if necessary  
Defect I 00 11 97 04 00


Gasket Steel  
Part I 11 62 8 576 287 1

Gasket Steel  
Part I 11 61 8 508 626 1


Pipe union  
Part I 11 71 7 799 853 2

exhaust cooler  
Part I 11 71 7 823 210 1

— 12/07/2018 Key 161959 km 32929 Eichhorn Automotive GmbH, Obernburg Kcy 0

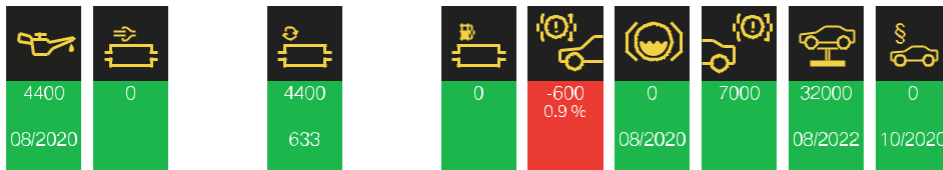

— 12/07/2018 Service 161959 km 32929 Eichhorn Automotive GmbH, Obernburg Automatic

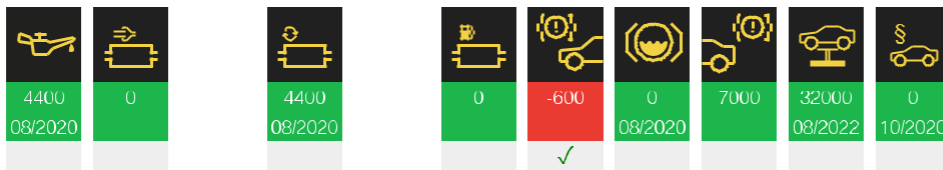

— 12/07/2018 Repair 161959 km 32929 Eichhorn Automotive GmbH, Obernburg Job Job Job

— Job



**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Vehicle check in course of reception

0 FRU

— Job

Is interpreted as a repeat visit: No

Customer's own words:

Removing and installing or replacing both front brake discs  
Flat rate unit I 34 11 613

3 FRU

Service - standard scope  
Flat rate unit I 00 00 105

2 FRU

Service, front brakes  
Flat rate unit I 00 00 612

7 FRU

Brake pad paste  
Part I 83 19 2 158 851

2

Brake pad wear sensor, front left  
Part I 34 35 6 790 303

1

Repair kit, brake pads asbestos-free  
Part I 34 10 6 859 182

1

Clip for brake pad wear sensor  
Part I 34 35 6 779 356

1

Inner hex bolt  
Part I 34 21 1 161 806

2

Brake disc, ventilated  
Part I 34 10 6 879 122

2

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:


Fetch and bring service zone  
Flat rate unit I 00 99 220

6 FRU

— 08/10/2018 Key

139767 km

32929 Eichhorn Key 0  
Automotive  
GmbH,  
Obernbürg

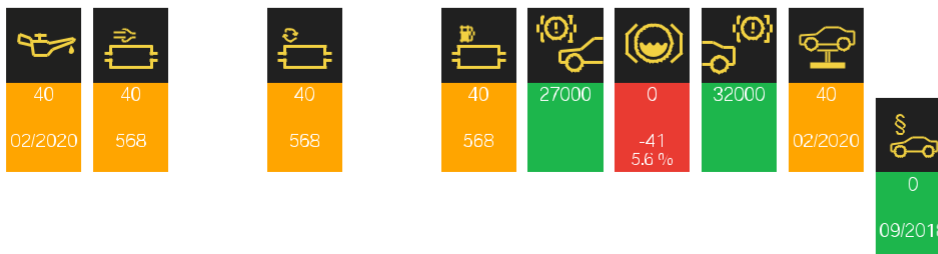

— 08/10/2018 Repair 139767 km 32929 Eichhorn Job  
Automotive Job  
GmbH, Job  
Obernbuurg Job  
Job  
Job  
Job  
Job  
Job

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Flat rate unit I -	0 FRU
--------------------	-------

---

Flat rate unit I -	0 FRU
--------------------	-------

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Vehicle check in course of reception	0 FRU
--------------------------------------	-------

Flat rate unit I 00 52 054

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Engine oil service	3 FRU
--------------------	-------

Flat rate unit I 00 00 610

---

Set oil-filter element	1
------------------------	---

Part I 11 42 8 507 683

---

Shell Helix Ultra ECT SAE 0W-30 BMW Longlife 04	Local	6.5
---	-------	-----

Part I FT9030

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Brake fluid service	4 FRU
---------------------	-------

Flat rate unit I 00 00 618

---

Brake fluid DOT4 LV, low viscosity	1
------------------------------------	---

Part I 83 13 2 184 843

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Service, vehicle check Flat rate unit I 00 00 624	6 FRU
--	-------

---

Windshield Washer Antifreeze Part I 83 12 2 409 031	1
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

---

Microfilter service Flat rate unit I 00 00 616	1 FRU
---	-------

---

Microfilter/activated Carbon container Part I 64 31 2 284 828	1
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

---

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

---

kostenlose Fahrzeugwäsche Flat rate unit I 99wasch	2 FRU
---	-------

---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

— Job

Description:

Is interpreted as a repeat visit: No


Customer's own words:

— 03/19/2018 Repair 113707 km 32929 Eichhorn Job  
Automotive  
GmbH,  
Obernburg


— Job



— 02/16/2018 Key 113707 km 32929 Eichhorn Key 0  
Automotive  
GmbH,  
Oberburg

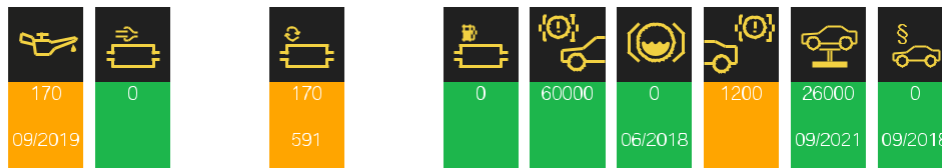

— 02/16/2018 Service 113707 km 32929 Eichhorn Automatic  
Automotive  
GmbH,  
Oberburg

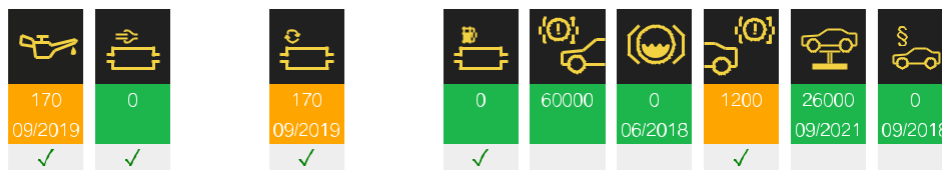

— 02/16/2018 Repair 113707 km 32929 Eichhorn Job  
Automotive Job  
GmbH, Job  
Oberburg Job  
Job  
Job  
Job  
Job  
Job

— Job  
Description:  
Is interpreted as a repeat visit: No  
Customer's own words:

— Job  
Description:  
Is interpreted as a repeat visit: No  
Customer's own words:

— Job  
Description:  
Is interpreted as a repeat visit: No  
Customer's own words:

Set oil-filter element Part I 11 42 8 507 683		1
Shell Helix Ultra ECT SAE 0W-30 BMW Longlife 04 Part I FT9030	Local	6.5

— Job

— Job

— Job

— Job

**Customer's own words:**

Brake disc, ventilated Part I 34 20 6 868 936		2
Inner hex bolt Part I 34 21 1 161 806		2
Brake pad paste Part I 83 19 2 158 851		2
Brake cleaner 2.0 Part I 83 19 2 413 695		1
Brake pad wear sensor, rear Part I 34 35 6 790 304		1
Repair kit, brake pads asbestos-free Part I 34 21 6 796 741		1

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

— 09/15/2017 Key 88379 km 32929 Eichhorn Key 0  
 Automotive GmbH, Obernburg



— 09/15/2017 Repair 88388 km 32929 Eichhorn Job  
 Automotive GmbH, Obernburg Job  
 Job  
 Job  
 Job  
 Job  
 Job  
 Job  
 Job  
 Job  
 Job  
 Job  
 Job

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

---

Flat rate unit I - 0 FRU

---

Flat rate unit I - 0 FRU

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Vehicle check in course of reception 0 FRU  
 Flat rate unit I 00 52 054

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Service, vehicle check Flat rate unit I 00 00 624	6 FRU
--	-------

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Service fuel filter Flat rate unit I 00 00 604	5 FRU
---	-------

---

Fuel filter cartridge Part I 13 32 8 584 874	1
---	---

---

Hose clamp Part I 16 12 1 180 240	1
--------------------------------------	---

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Service - air filter element Flat rate unit I 00 00 602	1 FRU
--	-------

---

Air filter element Part I 13 71 8 518 111	1
--	---

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Microfilter service Flat rate unit I 00 00 616	1 FRU
---	-------

---

Pollen filter housing cleaner Part I 83 19 2 180 509	1
---	---

---

Microfilter/activated Carbon container Part I 64 31 2 284 828	1
--	---

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Engine oil service Flat rate unit I 00 00 610		3 FRU
Set oil-filter element Part I 11 42 8 507 683		1
Shell Helix Ultra ECT SAE 0W-30 BMW Longlife 04 Part I FT9030	Local	6.5

— Job

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Removing and installing or replacing both front brake discs Flat rate unit I 34 11 613		3 FRU
Service, front brakes Flat rate unit I 00 00 612		7 FRU
Brake pad wear sensor, front left Part I 34 35 6 790 303		1
Brake pad paste Part I 83 19 2 158 851		2
Brake disc, ventilated Part I 34 10 6 879 122		2
Repair kit, brake pads asbestos-free Part I 34 10 6 859 182		1
Clip for brake pad wear sensor Part I 34 35 6 779 356		1
Inner hex bolt Part I 34 21 1 161 806		2

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:**

kostenlose Fahrzeugwäsche Flat rate unit I 99wasch		2 FRU
---	--	-------

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Performing vehicle test Flat rate unit I 00 00 556		2 FRU
---	--	-------


— Job

**Description:**






— 09/12/2017 Key 88188 km 32929 Eichhorn Key 0  
Automotive  
GmbH,  
Obernburg

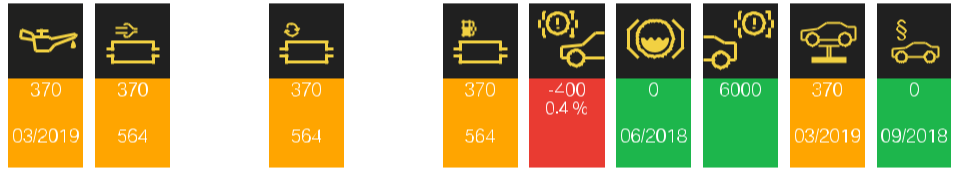

— 08/21/2017 Key 84247 km 32929 Eichhorn Key 0  
Automotive  
GmbH,  
Obernburg

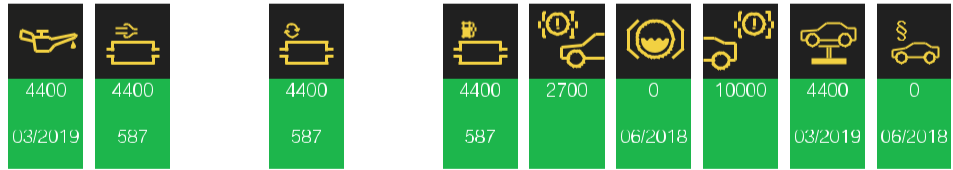

— 08/18/2017 Repair 84247 km 32929 Eichhorn Job  
Automotive  
GmbH,  
Obernburg

— Job

**Description:**


Is interpreted as a repeat visit: No

**Customer's own words:**

Replacing windshield Flat rate unit I 51 31 011	26 FRU
Bump stop Part I 51 31 2 996 980	12
Instruction notice, Airbag Part I 71 21 2 122 334	1
Clamp Part I 51 13 7 232 420	6
Clip Part I 51 31 7 255 727	2
Cover, windshield, top Part I 51 31 7 206 137	1
Rubber buffer Part I 51 31 1 925 433	3

Green windscrn,gr.shade band+rain sensor Part I 51 31 7 283 827		1
Schallisolierung Windlauf Part I 51 48 7 268 477	Local	1
SCHEIBENKLEBESATZ Part I FT995131	Local	1

— 06/06/2017 Key 73241 km 32929 Eichhorn Key 0  
Automotive GmbH, Obernburg

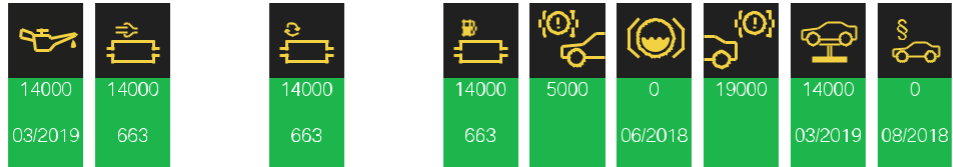

— 06/06/2017 Repair 73241 km 32929 Eichhorn Job  
Automotive GmbH, Obernburg Job

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Carry out Kinematics Diagnosis System wheel alignment with vehicle load up to design position  
Flat rate unit I 32 00 150

17 FRU

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Adjusting rear axle and front axle  
Flat rate unit I 32 00 630

9 FRU

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Service consultation at vehicle with Service Ticket  
Flat rate unit I 00 52 052

0 FRU

— 05/23/2017 Repair 78541 km 32929 Eichhorn Job  
Automotive GmbH, Obernburg

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Job time without allowance for / engine Flat rate unit I 11 99 000	21 FRU
---	--------

---

Mietwagen BMW 2er 11 Tage á 20,-- Part I FT9999lw1	Local	1
---	-------	---

— 04/18/2017 Repair 68456 km 32929 Eichhorn Job  
Automotive  
GmbH,  
Obensburg

— Job

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Replacing windshield Flat rate unit I 51 31 011	26 FRU
--	--------

---

Cover, windshield, top Part I 51 31 7 206 137	1
--	---

---

Rubber buffer Part I 51 31 1 925 433	7
---	---

---

Green windscrn,gr.shade band+rain sensor Part I 51 31 7 283 827	1
--	---

---

Bump stop Part I 51 31 7 288 462	10
-------------------------------------	----

---

Clamp Part I 51 13 7 232 420	6
---------------------------------	---

---

Clip, bottom left Part I 51 31 7 306 205	1
---	---

---

Clip, bottom right Part I 51 31 7 306 206	1
--	---

---


Sensorgel 2k 2x 2ml Part I FT0515151	Local	1
---	-------	---

---


SCHEIBENKLEBESATZ Part I FT995131	Local	1
--------------------------------------	-------	---

---

— 03/10/2017 Key 62865 km 32929 Eichhorn Key 0  
Automotive  
GmbH,  
Obensburg

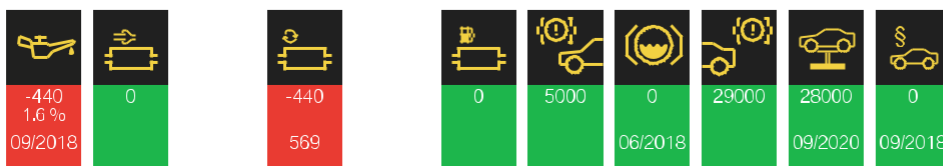

— 03/10/2017 Service 62865 km 32929 Eichhorn Automatic  
Automotive  
GmbH,  
Obernburg

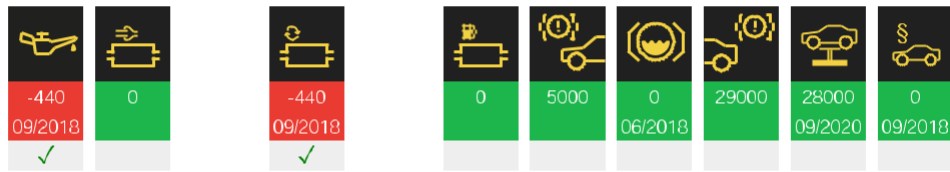

— 03/10/2017 Repair 62865 km 32929 Eichhorn Job  
Automotive Job  
GmbH, Job  
Obernburg Job  
Job

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Flat rate unit I - 0 FRU

Flat rate unit I - 0 FRU

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Vehicle check in course of reception 0 FRU  
Flat rate unit I 00 52 054

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Engine oil service 3 FRU  
Flat rate unit I 00 00 610

Set oil-filter element 1  
Part I 11 42 8 507 683

Motoröl ECT 0W30 Shell Helix Ultra 1000ML Local 6.5  
Part I 83 21 0 398 999

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Microfilter service 1 FRU  
Flat rate unit I 00 00 616

Microfilter/activated Carbon container  
Part I 64 31 2 284 828 1

---

Pollen filter housing cleaner  
Part I 83 19 2 180 509 1

---

— Job

— Job

— 09/28/2016 Repair 35641 km 32929 Eichhorn Job  
Automotive  
GmbH,  
Obernburg

— Job

Is interpreted as a repeat visit: No

Customer's own words:

---

Job time without allowance for / body equipment 72 FRU  
Flat rate unit I 72 99 000

---

Service, rear brakes 8 FRU  
Flat rate unit I 00 00 614

---

Service fuel filter 5 FRU  
Flat rate unit I 00 00 604

---

Service, vehicle check 6 FRU  
Flat rate unit I 00 00 624

---

Engine oil service 3 FRU  
Flat rate unit I 00 00 610

---

Exhaust emission inspection 6 FRU  
Flat rate unit I 00 00 440

---

Service - air filter element 1 FRU  
Flat rate unit I 00 00 602

---

Service - standard scope 2 FRU  
Flat rate unit I 00 00 105


---

Expanding rivet, black 8  
Part I 51 77 7 171 004


---

Brake pad wear sensor, rear Part I 34 35 6 790 304	1
<b>Bulb</b> Part I 63 21 7 160 805	1
Microfilter/activated Carbon container Part I 64 31 2 284 828	1
Repair kit, brake pads asbestos-free Part I 34 21 6 796 741	1
Hose clamp Part I 07 12 9 952 104	1
Air filter element Part I 13 71 8 518 111	1
Set oil-filter element Part I 11 42 8 507 683	1
Scdel. of tow.hitch+detach.ball head Part I 71 60 6 874 096	1
Fuel filter cartridge Part I 13 32 8 584 874	1
Retrofit kit, electr. additional parts Part I 71 60 2 183 705	1
Hauptuntersuchung lt.§29 netto Betrag intern Part I FT999924	Local 1
Motoröl ECT 0W30 Shell Helix Ultra 1000ML Part I 83 21 0 398 999	Local 6.5

— 09/23/2016 Key 35667 km 32929 Eichhorn Key 0  
Automotive GmbH, Obernburg

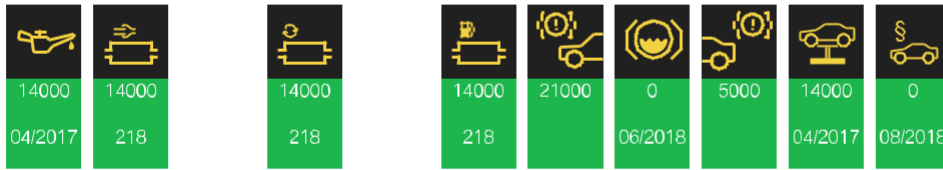


— 08/09/2016 Key 35641 km 32930 Eichhorn Key 0  
Automotive GmbH, Miltenberg

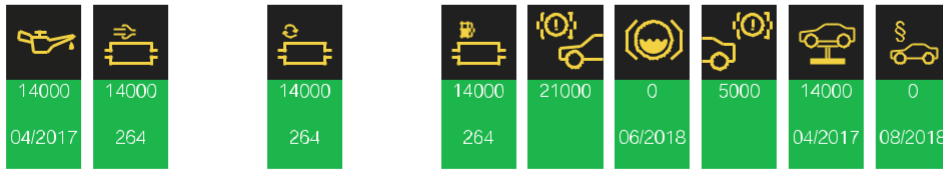

— 07/20/2016 Key 34539 km 32930 Eichhorn Key 0  
Automotive GmbH, Miltenberg



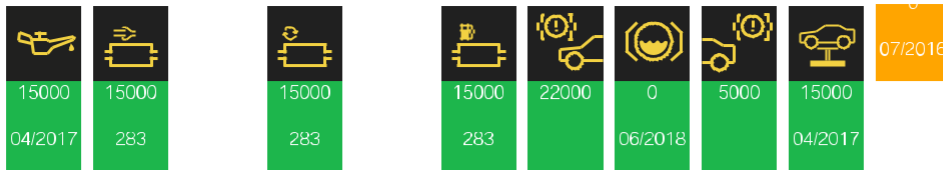


— 06/15/2016 Warranty 33722 km 32930 Eichhorn Automotive GmbH, Miltenberg Job: F25 F26 Rework ISOFIX mounting bow


— Job: F25 F26 Rework ISOFIX mounting bow



— 06/13/2016 Key 33722 km 32930 Eichhorn Automotive GmbH, Miltenberg Key 0

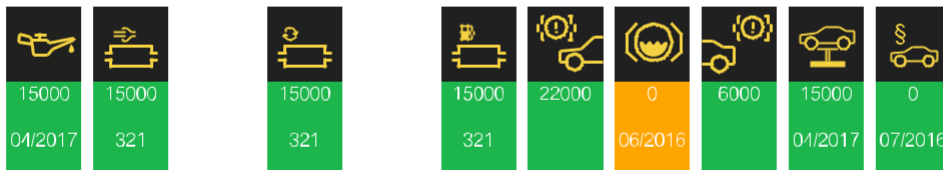

— 06/13/2016 Service 33722 km 32930 Eichhorn Automotive GmbH, Miltenberg Automatic

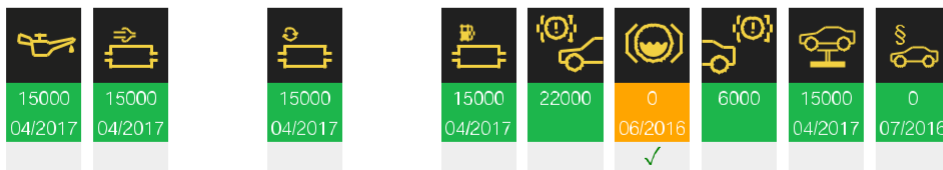

— 06/13/2016 Repair 33722 km 32930 Eichhorn Automotive GmbH, Miltenberg Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:



4 FRU


---

2 FRU

---

1

— 03/30/2016 Key 32450 km 32930 Eichhorn Automotive GmbH, Miltenberg Key 0

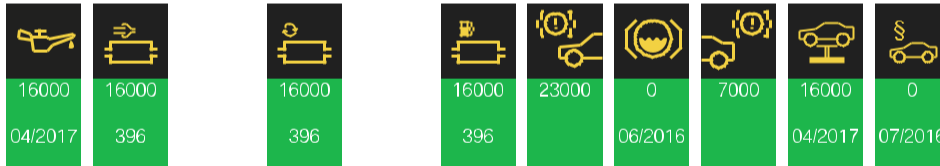

— 03/30/2016 Repair 32450 km 32930 Eichhorn Automotive GmbH, Miltenberg Job

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Sommerräder montieren Flat rate unit I 36 99 013 6 FRU

---

Windshield Washer Antifreeze Part I 83 12 2 409 031 1

---

Full Service Winterräder Reinigung und Einlagerung Local 1  
Part I FTF4wheels-

— 10/19/2015 Repair 29180 km 32930 Eichhorn Automotive GmbH, Miltenberg Job Job

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

---

Winterräder montieren Flat rate unit I 36 99 011 6 FRU

---

Full Service Sommerräder Reinigung und Einlagerung Local 1  
Part I FTF4wheels-

— Job

**Description:**

Is interpreted as a repeat visit: No



**Customer's own words:**

---

Light function test  
Flat rate unit I 00 12 290

2 FRU

— 10/09/2015 Warranty 28890 km 32930 Eichhorn Automotive GmbH, Miltenberg Job

— Job

— 10/08/2015 Warranty 28888 km 32930 Eichhorn Automotive GmbH, Miltenberg Job: Rotary latch lock/system lock, rear unpleasant noises  
Job: Front door trim panel (including function carrier, front door) Disruptive noises  
Job: Rear door trim panel (including function carrier, rear door) Disruptive noises  
Job: Front door seals unpleasant noises

— Job: Rotary latch lock/system lock, rear unpleasant noises

**Customer's own words:**

---

Performing vehicle test  
Flat rate unit I 00 00 006

0 FRU

---

Recharge vehicle battery  
Flat rate unit I 61 21 528

0 FRU

---

Remove and install/replace the door lock on the left or right rear doors  
Flat rate unit I 51 22 590

0 FRU

---

Rotary latch lock/system lock, rear unpleasant noises  
Defect I 51 22 02 39 00

---

System latch, left  
Part I 51 22 7 229 459

1

— Job: Front door trim panel (including function carrier, front door) Disruptive noises

**Description:** Front door trim panel (including function carrier, front door) Disruptive noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Removing and installing left or right front door trim panel  
Flat rate unit I 51 41 503

0 FRU

---

Job time without allowance for / body equipment  
Flat rate unit I 51 99 000

0 FRU

Front door trim panel (including function carrier, front door) Disruptive noises  
Defect I 51 41 00 39 00

Clip with washer, natur  
Part I 51 41 8 224 768 16

— Job: Rear door trim panel (including function carrier, rear door) Disruptive noises

**Description:** Rear door trim panel (including function carrier, rear door) Disruptive noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Removing and installing left or right rear door trim panel  
Flat rate unit I 51 42 503 0 FRU

Job time without allowance for / body  
Flat rate unit I 41 99 000 0 FRU

Rear door trim panel (including function carrier, rear door) Disruptive noises  
Defect I 51 42 00 39 00

Clip with washer, natur  
Part I 51 41 8 224 768 14

— Job: Front door seals unpleasant noises

**Description:** Front door seals unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**


Localizing body problem(s)  
Flat rate unit I 51 00 001 0 FRU

Job time without allowance for / body  
Flat rate unit I 41 99 000 0 FRU

Front door seals unpleasant noises  
Defect I 51 71 00 39 00


Adhesive tape  
Part I 51 41 8 170 727 5

— 10/07/2015 Key 28883 km 32930 Eichhorn Key 0  
Automotive GmbH,  
Miltenberg

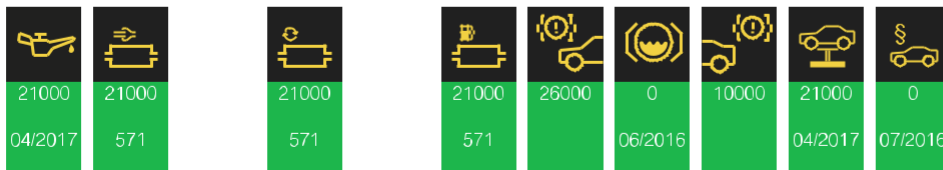

— 08/26/2015 Key 26944 km 32930 Eichhorn Key 0  
Automotive GmbH,  
Miltenberg



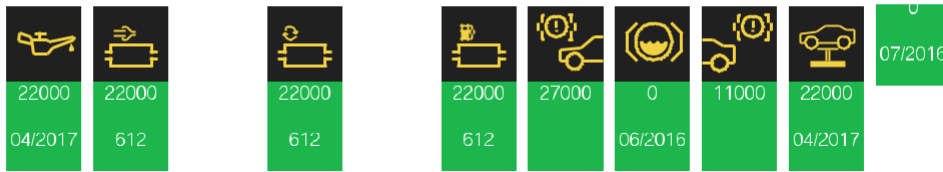

- 05/19/2015 Warranty 24234 km 32930 Eichhorn Automotive GmbH, Miltenberg Job: Front brake discs corroded  
Job: Parking brake control module occasional malfunction  
Job: Rear-view mirror, outside, drive on flaps permanent failure

— Job: Front brake discs corroded

**Description:** Front brake discs corroded

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Repair solution for brake disc corrosion (4 brake discs) Flat rate unit I 34 99 525	28 FRU
--	--------

Front brake discs corroded Defect I 34 11 00 75 00
---

— Job: Parking brake control module occasional malfunction

**Description:** Parking brake control module occasional malfunction

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Job time without allowance for / brakes Flat rate unit I 34 99 000	2 FRU
---	-------

Performing vehicle test Flat rate unit I 00 00 006	4 FRU
---	-------

Recharge vehicle battery Flat rate unit I 61 21 528	1 FRU
--	-------

Parking brake control module occasional malfunction Defect I 34 43 00 14 00
--

— Job: Rear-view mirror, outside, drive on flaps permanent failure

**Description:** Rear-view mirror, outside, drive on flaps permanent failure

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Performing vehicle test Flat rate unit I 00 00 556	2 FRU
---	-------


Removing and installing/replacing exterior mirror on left or right front door Flat rate unit I 51 16 500	5 FRU
---	-------

Vehicle diagnosis - carrying out the ABL Flat rate unit I 61 00 006	3 FRU
--	-------


Rear-view mirror, outside, drive on flaps permanent failure Defect I 67 13 05 12 00
--

Outside mirror w/out glass heated right Part I 51 16 7 264 118	1
---	---

— 05/05/2015 Key 23865 km 32930 Eichhorn Key 0  
Automotive  
GmbH,  
Miltenberg

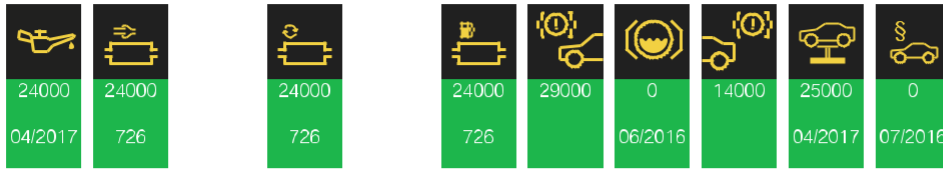

— 04/29/2015 Key 23714 km 32930 Eichhorn Key 0  
Automotive  
GmbH,  
Miltenberg

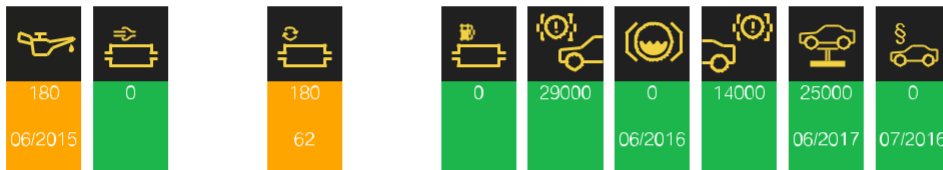

— 04/29/2015 Repair 23714 km 32930 Eichhorn Job  
Automotive  
GmbH,  
Miltenberg

— Job

**Customer's own words:**

Engine oil service Flat rate unit I 00 00 610	3 FRU
Service - standard scope Flat rate unit I 00 00 105	2 FRU
Microfilter service Flat rate unit I 00 00 616	1 FRU
Set oil-filter element Part I 11 42 8 507 683	1
Microfilter/activated Carbon container Part I 64 31 2 284 828	1
Motoröl ECT 0W30 Shell Helix Ultra 1000ML Part I 83 21 0 398 999	Local 6.5

— Job


**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

Vehicle check in course of reception Flat rate unit I 00 52 054	0 FRU
--	-------

— 04/14/2015 Key 23145 km 32930 Eichhorn Key 0

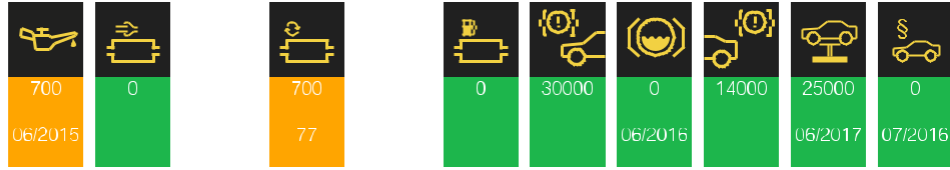

— 04/14/2015 Repair 23145 km 32930 Eichhorn Automotive GmbH, Miltenberg Job Job

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

Sommerräder montieren 802235390 6 FRU  
Flat rate unit I 36 99 013

Full Service Winterräder Reinigung und Einlagerung Local 1  
Part I FTF4wheels-

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

Vehicle check in course of reception 0 FRU  
Flat rate unit I 00 52 054

— 12/12/2014 Warranty 20737 km 32930 Eichhorn Automotive GmbH, Miltenberg Job: Front door trim panel (including function carrier, front door) Disruptive noises

— Job: Front door trim panel (including function carrier, front door) Disruptive noises

**Description:** Front door trim panel (including function carrier, front door) Disruptive noises

Is interpreted as a repeat visit: No

**Customer's own words:**

Removing and installing or replacing door window frame left or right interior trim 0 FRU  
Flat rate unit I 51 34 660

Removing and installing or replacing door window frame left or right interior trim 0 FRU  
Flat rate unit I 51 32 660

Replacing left or right rear door trim panel 0 FRU  
Flat rate unit I 51 42 504

Replacing left or right front door trim panel 0 FRU  
Flat rate unit I 51 41 504

Replacing sealing on rear left or right door Flat rate unit I 51 71 715	0 FRU
Replacing sealing on front left or right door Flat rate unit I 51 71 615	0 FRU
Replace edge protection for left or right rear door Flat rate unit I 51 72 516	0 FRU
Replacing edge protection for left or right front door Flat rate unit I 51 72 510	0 FRU
Recharge vehicle battery Flat rate unit I 61 21 528	0 FRU
Performing vehicle test Flat rate unit I 00 00 006	0 FRU
Front door trim panel (including function carrier, front door) Disruptive noises Defect I 51 41 00 39 00	
Edge protection, door, rear Part I 51 72 7 396 556	1
Loudspeaker cover Part I 51 41 6 969 384	2
Sound insulating door rear left Part I 51 48 7 351 207	1
Edge protection, door, front Part I 51 72 7 396 554	1
Door opener, front left Part I 51 41 7 237 713	1
Axial securing clip Part I 07 14 9 158 226	1
Clip, speaker cover Part I 07 14 7 243 883	6
Cover, window frame, door front left Part I 51 33 7 205 583	1
Door weatherstrip front Part I 51 33 7 300 242	1
Door weatherstrip rear Part I 51 22 7 300 249	1
Window guide, left front door Part I 51 31 7 311 261	1
Door trim panel, rear, left Part I 51 42 7 279 915	1
Sound insulating door front left Part I 51 48 7 351 195	1
Window guide, left rear door Part I 51 35 7 311 265	1
Door trim panel, front left Part I 51 41 7 394 519	1

— Job: Front door trim panel (including function carrier, front door) Disruptive noises

**Description:** Front door trim panel (including function carrier, front door) Disruptive noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Removing and installing or replacing door window frame left or right interior trim Flat rate unit I 51 32 660	6 FRU
--	-------

Replacing sealing on rear left or right door Flat rate unit I 51 71 715	8 FRU
--	-------

Replacing left or right rear door trim panel Flat rate unit I 51 42 504	7 FRU
--	-------

Replacing sealing on front left or right door Flat rate unit I 51 71 615	8 FRU
---	-------

Replacing edge protection for left or right front door Flat rate unit I 51 72 510	4 FRU
--	-------

Replace edge protection for left or right rear door Flat rate unit I 51 72 516	3 FRU
---	-------

Removing and installing or replacing door window frame left or right interior trim Flat rate unit I 51 34 660	5 FRU
--	-------

Performing vehicle test Flat rate unit I 00 00 006	4 FRU
---	-------

Replacing left or right front door trim panel Flat rate unit I 51 41 504	8 FRU
---	-------

Recharge vehicle battery Flat rate unit I 61 21 528	1 FRU
--	-------

Front door trim panel (including function carrier, front door) Disruptive noises Defect I 51 41 00 39 00	
---	--

Door weatherstrip rear Part I 51 22 7 300 249	1
--	---

Clip, speaker cover Part I 07 14 7 243 883	6
---	---

Door opener, front left Part I 51 41 7 237 713	1
---	---

Window guide, left rear door Part I 51 35 7 311 265	1
--	---


Door weatherstrip front Part I 51 33 7 300 242	1
---	---

Cover, window frame, door front left Part I 51 33 7 205 583	1
--	---


Window guide, left front door Part I 51 31 7 311 261	1
---	---

Sound insulating door rear left Part I 51 48 7 351 207	1
Sound insulating door front left Part I 51 48 7 351 195	1
Door trim panel, rear, left Part I 51 42 7 279 915	1
Door trim panel, front left Part I 51 41 7 394 519	1
Axial securing clip Part I 07 14 9 158 226	1
Loudspeaker cover Part I 51 41 6 969 384	2
Edge protection, door, rear Part I 51 72 7 396 556	1
Edge protection, door, front Part I 51 72 7 396 554	1

— 12/10/2014 Key 20737 km 32930 Eichhorn Automotive GmbH, Miltenberg Key 0

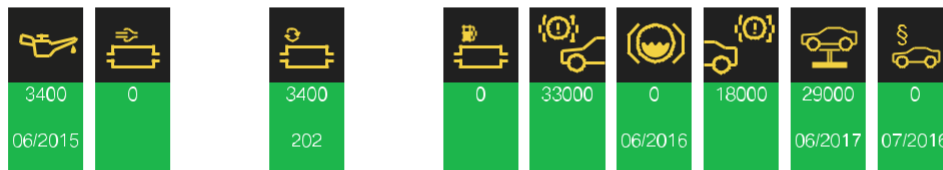

— 10/27/2014 Key 19533 km 32930 Eichhorn Automotive GmbH, Miltenberg Key 0

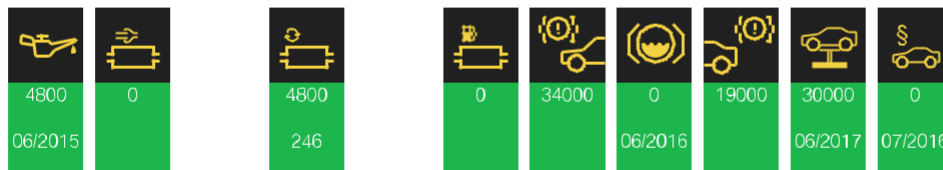

— 10/27/2014 Warranty 19533 km 32930 Eichhorn Automotive GmbH, Miltenberg Job: Front door trim panel (including function carrier, front door) Disruptive noises

— Job: Front door trim panel (including function carrier, front door) Disruptive noises

**Description:** Front door trim panel (including function carrier, front door) Disruptive noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Job time without allowance for / body equipment 0 FRU  
Flat rate unit I 51 99 000

Removing and installing left or right front door trim panel 0 FRU  
Flat rate unit I 51 41 503

Performing vehicle test 0 FRU



Flat rate unit I 00 00 006

Recharge vehicle battery  
Flat rate unit I 61 21 528

0 FRU

Front door trim panel (including function carrier, front door) Disruptive noises  
Defect I 51 41 00 39 00


Clip with washer, natur  
Part I 51 41 8 224 768

5

Set felt strip self-adhesive  
Part I 51 45 2 353 024

1

— 10/10/2014 Key 17720 km 32930 Eichhorn Key 0  
Automotive  
GmbH,  
Miltenberg

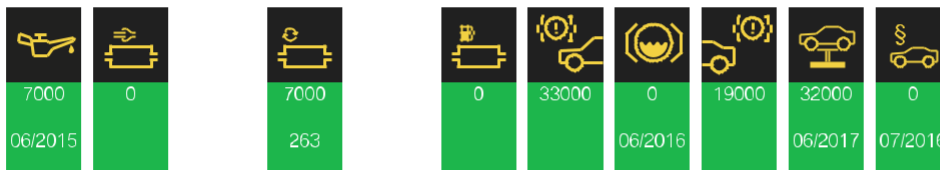

— 10/10/2014 Repair 17720 km 32930 Eichhorn Job  
Automotive Job  
GmbH,  
Miltenberg

— Job

**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Winterräder montieren 405620288  
Flat rate unit I 36 99 011

6 FRU

Full Service Sommerräder Reinigung und Einlagerung  
Part I FTF4wheels-

Local

1

— Job

**Description:**

Is interpreted as a repeat visit: No


Customer's own words:

Vehicle check in course of reception  
Flat rate unit I 00 52 054


0 FRU

— 10/06/2014 Key 17647 km 32930 Eichhorn Key 0  
Automotive  
GmbH,  
Miltenberg



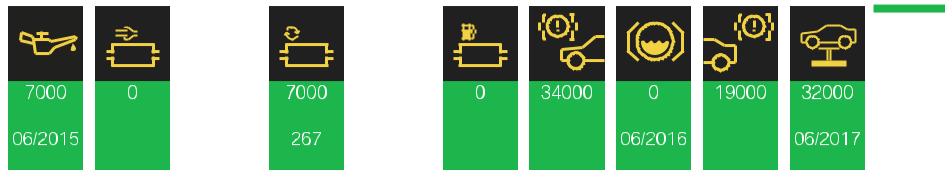


— 09/30/2014 Key 17484 km 32930 Eichhorn Automotive GmbH, Miltenberg Key 0

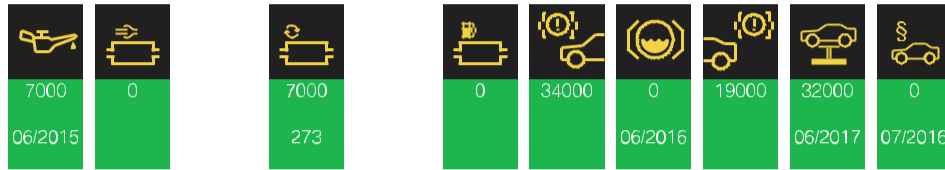

— 09/30/2014 Warranty 17484 km 32930 Eichhorn Automotive GmbH, Miltenberg Job: Front door trim panel (including function carrier, front door) Disruptive noises

— Job: Front door trim panel (including function carrier, front door) Disruptive noises

— 03/28/2014 Key 10657 km 32930 Eichhorn Automotive GmbH, Miltenberg Key 0

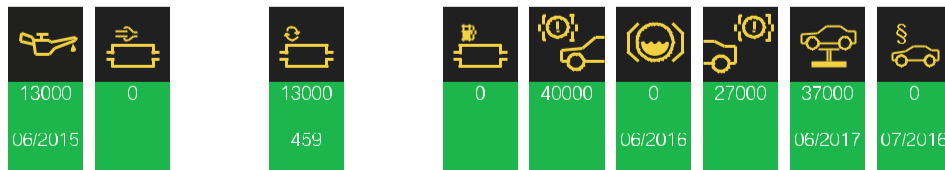


— 03/28/2014 Repair 10657 km 32930 Eichhorn Automotive GmbH, Miltenberg Job Job

— Job

Description:

— 01/10/2014 Key 8131 km 32930 Eichhorn Key 0  
Automotive  
GmbH,  
Miltenberg

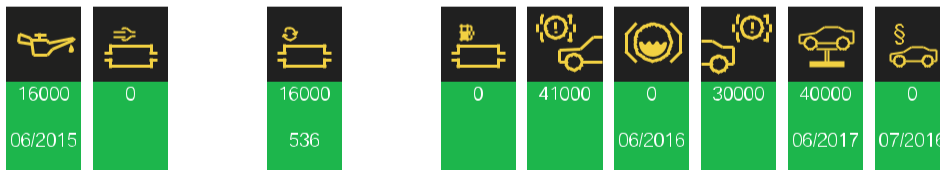

— 01/10/2014 Warranty 8144 km 32930 Eichhorn Job: Sunroof visor (SHD, panorama  
Automotive roof) unpleasant noises  
GmbH, Job: Boot lid lock with microswitch  
Miltenberg unpleasant noises

— Job: Sunroof visor (SHD, panorama roof) unpleasant noises

**Description:** Sunroof visor (SHD, panorama roof) unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Removing and installing front glass slide/tilt sunroof cover 3 FRU  
Flat rate unit I 54 10 670

Working time without specification/SHD and convertible top 8 FRU  
Flat rate unit I 54 99 000

Recharge vehicle battery 1 FRU  
Flat rate unit I 61 21 528

Vehicle diagnosis - carrying out the ABL 1 FRU  
Flat rate unit I 61 00 006


Performing vehicle test 4 FRU  
Flat rate unit I 00 00 006

Sunroof visor (SHD, panorama roof) unpleasant noises  
Defect I 54 12 09 39 00

Felt strip, self-adhesive 1  
Part I 54 34 7 248 700

— Job: Boot lid lock with microswitch unpleasant noises

— 12/09/2013 Key 7277 km 32930 Eichhorn Automotive GmbH, Miltenberg Key 0

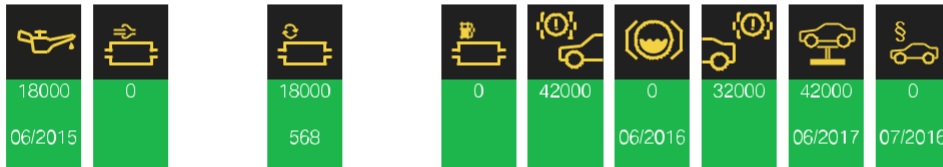

— 12/09/2013 Warranty 7293 km 32930 Eichhorn Automotive GmbH, Miltenberg

Job: Front doors poorly adapted/fitted  
 Job: Outer door handles/strip handles, front (including electronic outer door handle module TAGE) unpleas  
 Job: Window frame cover unpleasant noises  
 Job: Front door trim panel (including function carrier, front door) Disruptive noises  
 Job: B-pillar trim panel (inner) unpleasant noises  
 Job: Roller blind in luggage compartment unpleasant noises  
 Job: Backrest latch / rear seat adjustment unpleasant noises  
 Job: Sunroof visor (SHD, panorama roof) unpleasant noises

— Job: Front doors poorly adapted/fitted

**Description:** Front doors poorly adapted/fitted

**Is interpreted as a repeat visit:** No

**Customer's own words:**

Vehicle diagnosis - carrying out the ABL Flat rate unit I 61 00 006	6 FRU
Adjusting front left or right door Flat rate unit I 41 51 504	2 FRU
Performing vehicle test Flat rate unit I 00 00 006	4 FRU
Recharge vehicle battery Flat rate unit I 61 21 528	1 FRU

Front doors poorly adapted/fitted

Defect I 41 51 00 41 00

- Job: Outer door handles/strip handles, front (including electronic outer door handle module TAGE) unpleas

**Description:** Outer door handles/strip handles, front (including electronic outer door handle module TAGE) unpleas

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Removing and installing/replacing the outside door handle at the front left or right Flat rate unit I 51 21 770	2 FRU
--	-------

---

Outer door handles/strip handles, front (including electronic outer door handle module TAGE) unpleas  
Defect I 51 21 05 39 00

- Job: Window frame cover unpleasant noises

**Description:** Window frame cover unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Removing and installing or replacing door window frame left or right interior trim Flat rate unit I 51 32 660	6 FRU
--	-------

---

Localizing body problem(s) Flat rate unit I 51 00 001	3 FRU
--	-------

---

Window frame cover unpleasant noises  
Defect I 51 33 19 39 00

---

Felt strip, self-adhesive Part I 54 34 7 248 700	1
---	---

---

- Job: Front door trim panel (including function carrier, front door) Disruptive noises

**Description:** Front door trim panel (including function carrier, front door) Disruptive noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Removing and installing left or right front door trim panel Flat rate unit I 51 41 503	4 FRU
---	-------

---

Job time without allowance for / body equipment Flat rate unit I 51 99 000	6 FRU
---	-------

---

Front door trim panel (including function carrier, front door) Disruptive noises  
Defect I 51 41 00 39 00

---

Clip with washer, natur Part I 51 41 8 224 768	12
---	----

---

- Job: B-pillar trim panel (inner) unpleasant noises

**Description:** B-pillar trim panel (inner) unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Removing and installing or replacing trim panel at top of left or right door pillar	2 FRU
---	-------

Flat rate unit I 51 43 648

B-pillar trim panel (inner) unpleasant noises  
Defect I 51 43 05 39 00

- Job: Roller blind in luggage compartment unpleasant noises

**Description:** Roller blind in luggage compartment unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Rcmoving and installing/rcplacing roller cover for luggage compartment 1 FRU  
Flat rate unit I 51 47 645

---

Roller blind in luggage compartment unpleasant noises  
Defect I 51 47 08 39 00

- Job: Backrest latch / rear seat adjustment unpleasant noises

**Description:** Backrest latch / rear seat adjustment unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Job time without allowance for / seats 2 FRU  
Flat rate unit I 52 99 000

---

Backrest latch / rear seat adjustment unpleasant noises  
Defect I 52 20 15 39 00

- Job: Sunroof visor (SHD, panorama roof) unpleasant noises

**Description:** Sunroof visor (SHD, panorama roof) unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Working time without specification/SHD and convertible top 6 FRU  
Flat rate unit I 54 99 000

---

Sunroof visor (SHD, panorama roof) unpleasant noises  
Defect I 54 12 09 39 00

- 11/14/2013 Warranty 5155 km 32930 Eichhorn Automotive GmbH, Miltenberg  
Job: Window frame cover unpleasant noises  
Job: Front doors poorly adapted/fitted  
Job: B-pillar trim panel (inner) unpleasant noises  
Job: Trunk lid poorly adapted/fitted

- Job: Window frame cover unpleasant noises

**Description:** Window frame cover unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Performing vehicle test 2 FRU  
Flat rate unit I 00 00 556

---

Recharge vehicle battery 1 FRU  
Flat rate unit I 61 21 528

---

Localizing body problem(s) 6 FRU

Flat rate unit I 51 00 001

---

Removing and installing or replacing door window frame left or right interior trim 6 FRU  
Flat rate unit I 51 32 660

---

Window frame cover unpleasant noises  
Defect I 51 33 19 39 00

---

Cover, window frame, door front left 1  
Part I 51 33 7 205 583

---

Plug-in retainer 2  
Part I 07 14 6 957 034

---

— Job: Front doors poorly adapted/fitted

**Description:** Front doors poorly adapted/fitted

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Adjusting front left or right door 2 FRU  
Flat rate unit I 41 51 504

---

Front doors poorly adapted/fitted  
Defect I 41 51 00 41 00

---

— Job: B-pillar trim panel (inner) unpleasant noises

**Description:** B-pillar trim panel (inner) unpleasant noises

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Removing and installing or replacing trim panel for left or right door pillar 6 FRU  
Flat rate unit I 51 43 650

---

Job time without allowance for / body equipment 1 FRU  
Flat rate unit I 51 99 000

---

B-pillar trim panel (inner) unpleasant noises  
Defect I 51 43 05 39 00

---

Felt strip, self-adhesive 2  
Part I 54 34 7 248 700

---

— Job: Trunk lid poorly adapted/fitted

**Description:** Trunk lid poorly adapted/fitted

**Is interpreted as a repeat visit:** No

**Customer's own words:**

---

Adjusting rear lid 5 FRU  
Flat rate unit I 41 62 514


---

Trunk lid poorly adapted/fitted  
Defect I 41 62 00 41 00

---

— 10/17/2013 Key 5142 km 32930 Eichhorn Key 0  
Automotive  
GmbH,  
Miltenberg



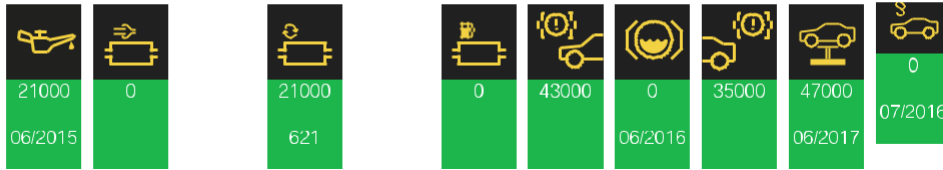

— 10/17/2013 Repair 5143 km 32930 Eichhorn Automotive GmbH, Miltenberg Job Job Job

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

Winterräder montieren 6 FRU  
Flat rate unit I 36 99 011

Full Service Sommerräder Reinigung und Einlagerung Local 1  
Part I FTF4wheels-

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

Light function test 2 FRU  
Flat rate unit I 00 12 290

— Job

**Description:**

Is interpreted as a repeat visit: No

**Customer's own words:**

Vehicle check in course of reception 0 FRU  
Flat rate unit I 00 52 054

— 09/27/2013 Warranty 4014 km 32930 Eichhorn Automotive GmbH, Miltenberg Job: Instrument panel trim, bottom (incl. knee pad) unpleasant noises

— Job: Instrument panel trim, bottom (incl. knee pad) unpleasant noises

**Description:** Instrument panel trim, bottom (incl. knee pad) unpleasant noises

Is interpreted as a repeat visit: No

**Customer's own words:**

Remove and install pedal trim 1 FRU  
Flat rate unit I 51 45 684

Performing vehicle test 2 FRU  
Flat rate unit I 00 00 556

Job time without allowance for / body equipment 7 FRU  
Flat rate unit I 51 99 000



Removing and installing left or right front door trim panel  
Flat rate unit I 51 41 503 4 FRU

Instrument panel trim, bottom (incl. knee pad) unpleasant noises  
Defect I 51 45 02 39 00

Clip with washer, natur  
Part I 51 41 8 224 768 15

— 09/26/2013 Repair 4014 km 32930 Eichhorn Job  
Automotive Job  
GmbH, Job  
Miltenberg

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:** none

Verkaufsdurchsicht VFW  
Flat rate unit I - 4 FRU

Longlife bulb  
Part I 63 21 7 160 797 1

— Job

**Description:**

**Is interpreted as a repeat visit:** No

**Customer's own words:** none

Fahrzeug betanken (15 Liter)  
Flat rate unit I - 2 FRU

 
 
 
 
 
 
— Job

**Description:**

**Is interpreted as a repeat visit:** No



**Customer's own words:** Ausl.: 30.09.2013 10:30 Uhr  
Kunde: Herth VK: TL

— 07/22/2013 Key 177 km 32930 Eichhorn Key 0  
Automotive  
GmbH,  
Miltenberg



— 07/15/2013 Key 4 km 32930 Eichhorn Key 0  
Automotive

GmbH,  
Miltenberg

	
0	0
-5 0.7%	-5 0.7%

— 07/15/2013 Repair 0 km 32930 Eichhorn Job  
Automotive Job  
GmbH, Job  
Miltenberg

— Job

Is interpreted as a repeat visit: No

Customer's own words:

---

Pre-delivery check, splash water pump, winter tyres and interior mirror with digital compass 1 FRU  
Flat rate unit I 00 00 746

---

Pre-delivery check of service and parking brakes with transport and immobilisation periods of 3-6 weeks 1 FRU  
Flat rate unit I 00 00 742

---

Suspension block delivery inspection 1 FRU  
Flat rate unit I 00 00 741

---

Free pre-delivery check 9 FRU  
Flat rate unit I 00 00 009

---

Pre-delivery check, electronic battery master switch 2 FRU  
Flat rate unit I 00 00 740

---

Windshield Washer Antifreeze 1  
Part I 83 12 2 298 206

---

BMW warning vst, sct of 2 1  
Part I 82 26 2 311 350

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeug bekleben 4 FRU  
Flat rate unit I -

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

---

Installing the navigation map(s) 2 FRU  
Flat rate unit I 65 90 600

---

Enable code CHAMP2 map Europe, initial 1

